

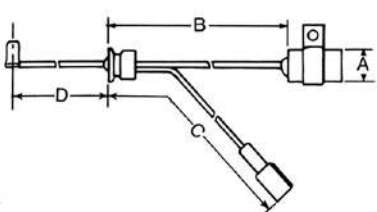
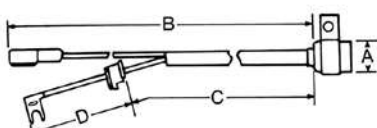
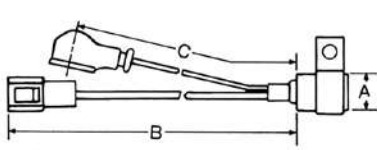
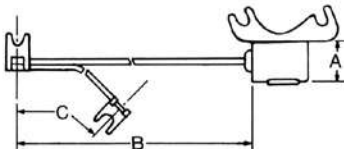


# DISTRIBUTOR CONDENSERS







## SPECIFICATIONS

Illustration	New-Era No.	TYPE	$\mu F$	A <sup>m/m</sup>	B <sup>m/m</sup>	C <sup>m/m</sup>	D <sup>m/m</sup>
<b>TYPE 1</b> 	3NC-27	1	0.22	17.5 $\phi$	120		
	3NC-31	1	0.22	17.5 $\phi$	95		
	3NC-33	1	0.22	17.5 $\phi$	60		
	3NC-36	1	0.27	17.5 $\phi$	69		
	3NC-38	2	0.22	15 $\phi$	93	117	50
	3NC-40	2	0.22	15 $\phi$	97	57	85
<b>TYPE 2</b> 	3NC-41	2	0.22	15 $\phi$	97	57	85
	3NC-42	1	0.22	15 $\phi$	61		
	3NC-43	1	0.22	15 $\phi$	62		
	3NC-46	2	0.22	15 $\phi$	110	105	43
	3NC-47	1	0.27	15 $\phi$	125		
	<b>TYPE 3</b> 	3NC-48	4	0.22	15 $\phi$	205	100
3NC-49		1	0.27	15 $\phi$	59		
4NC-67		6	0.22	17 $\phi$	35		
4NC-69		1	0.22	17 $\phi$	85		
4NC-70		1	0.25	17 $\phi$	71		
4NC-73		1	0.22	15 $\phi$	110		
<b>TYPE 4</b> 	4NC-74	1	0.25	15 $\phi$	115		
	4NC-75	1	0.15	17 $\phi$	75		
	4NC-76	6	0.15	17 $\phi$			
	4NC-79	1	0.25	17 $\phi$	74		
	4NC-80	1	0.18	15 $\phi$	95		
	<b>TYPE 5</b> 	4NC-81	1	0.27	15 $\phi$	95	
4NC-82		4	0.25	15 $\phi$	180	110	
4NC-83		4	0.25	15 $\phi$	180	110	
4NC-86		1	0.22	17.5 $\phi$	70		
4NC-87		1	0.22	17.5 $\phi$	107		
4NC-89		5	0.22	15 $\phi$	95		
<b>TYPE 6</b> 	4NC-91	6	0.22	17 $\phi$			
	4NC-92	4	0.25	15 $\phi$	197	108	
	4NC-93	1	0.22	15 $\phi$	70		
	4NC-95	10	0.22	15 $\phi$	130	85	
	4NC-96	11	0.22	15 $\phi$	150	93	50

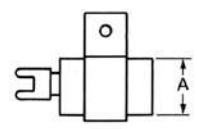


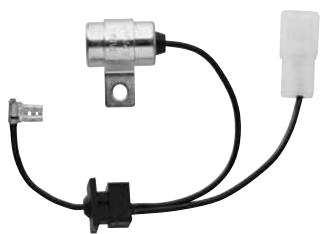
DISTRIBUTOR CONDENSERS

# DISTRIBUTOR CONDENSERS
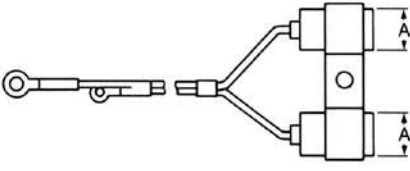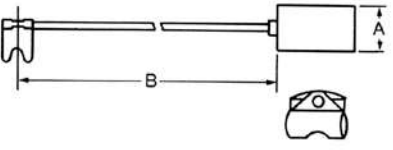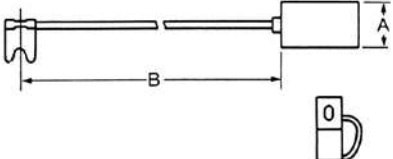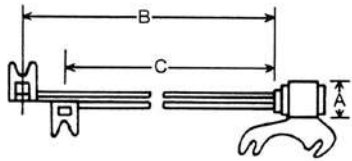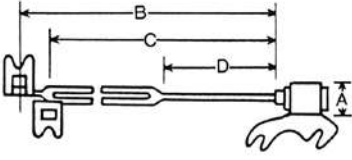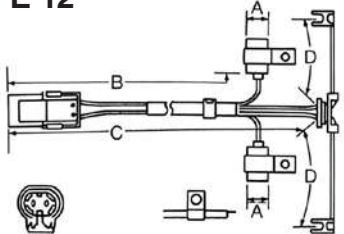
## SPECIFICATIONS


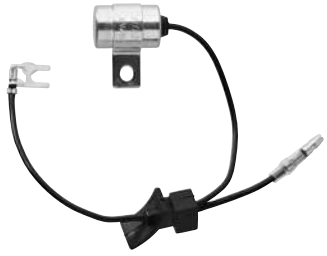

Illustration	New-Era No.	TYPE	$\mu F$	A <sup>m/m</sup>	B <sup>m/m</sup>	C <sup>m/m</sup>	D <sup>m/m</sup>
<b>TYPE 7</b> 	4NC-100	12	0.05/0.22	13 $\phi$	270	275	56/76
	4NC-173	1	0.22	15 $\phi$	115		
	4NC-174	1	0.25	15 $\phi$	115		
	4NC-273	1	0.22	15 $\phi$	130		
	4NC-7315	1	0.15	15 $\phi$	115		
<b>TYPE 8</b> 	NCD-551	8	0.22	17 $\phi$	65		
	NCD-553	8	0.22	17 $\phi$	65		
	NCD-554	8	0.22	17 $\phi$	105		
	NCD-556	9	0.22	17 $\phi$	105		
<b>TYPE 9</b> 							
<b>TYPE 10</b> 							
<b>TYPE 11</b> 							
<b>TYPE 12</b> 							

# DISTRIBUTOR CONDENSERS


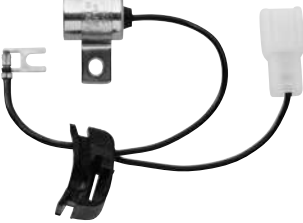
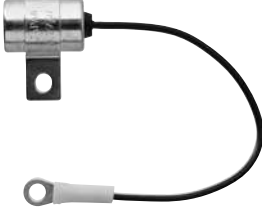
New-Era No.	Ref.No.	Application
<b>3NC-27</b>  <b>0.22<math>\mu</math>F</b>	<b>0221-24-485</b> <b>0249-24-345</b>  <b>T315T20571 MI</b> <b>T315T20573 MI</b> <b>T315T22971 MI</b>	<b>MAZDA</b> FAMILIA 1000 SP, MP, BP 67~74 1200 MTA, MTB, MTC, STA, STB, STC 68~74 TRUCK 1000 BPB55, BPB65, BTC65 67~79 1200 BTA55, BTA65 68~74 BONGO FPA, FPA75, FPAH, FPAV 68~79 CRAFT 1500, 1600 DUC, DUE, DUE91, DUE95 71~77 PROCEED BUD 65~72 TUC 65~73 T1500 TUC 65~73 T2000 TVB 65~73 E2000 EVB 65~73 LUCE 1500 SU 70~73
<b>3NC-31</b>  <b>0.22<math>\mu</math>F</b>	<b>0324-24-345A</b> <b>(D27Z-12300B)</b>  <b>T315T22072 MI</b>	<b>MAZDA</b> LUCE 1800 SVA, SV3 71~73 CAPELLA 1500, 1600 SU, MU, SN, MN 71~73 1800 EXPORT 71~72 FAMILIA 1500 71~ PRESTO 1000, 1300 MP, SP, ST, MT 71~74 GRAND FAMILIA 1600 EXPORT 71~74 PROCEED EXPORT 71~74 1300, 1600 BTA67, BNA61, BNB61 71~74
<b>3NC-36</b>  <b>0.27<math>\mu</math>F</b>	<b>1757-24-322</b>  <b>T315T21671 MI</b>	<b>MAZDA</b> LUCE EXPORT 73~ ROTARY EXPORT 73~75 AP C-LA22, 32, 52, 53, 62, 63 73~79 CAPELLA EXPORT 73~75 AP C-CB, CB, S123, M123 73~77 SAVANNA EXPORT 73~ AP S124, M124, B-S124AB, B-S124W 73~77 COSMO EXPORT CD23, 43, 63 75~79 AP CD22, CD32, CD33 75~77 ROADPACER RA13S, C-RA13J, C-RA33S 76~77 AP RA13SY, RA13SYU 75~ PROCEED EXPORT 74~75
<b>3NC-38</b>  <b>0.22<math>\mu</math>F</b>	<b>0453-24-322</b> <b>(D47Z-12300A)</b>  <b>T315T21371 MI</b> <b>T315T22271 MI</b>	<b>MAZDA</b> LUCE 1800 LA2VS, LA2VH, LA2VV 73~75 CAPELLA 1800 CBIVC, CBIVS 73~75 1600 EXPORT SNF 73~76 1600AP SNF, SNG, SNH, SNK, SNL, SN2, MN2 73~76 FAMILIA 1300 73~75 PRESTO 1000, 1300 MP, SP, MT 73~75 GRAND FAMILIA 1300, 1600 73~76 1600 SN3, MT3, ST3, FA3 EXPORT 73~74 PROCEED 1300, 1600 BNA, BAB, BTA67 73~76 1800 EXPORT 73~75

DISTRIBUTOR CONDENSERS





# DISTRIBUTOR CONDENSERS

New-Era No.	Ref.No.	Application
<b>3NC-40</b> <b>0.22<math>\mu</math>F</b> 	<b>MD607041</b> <b>MD607118</b>  <b>T315T11271 MI</b> <b>T315T22571 MI</b>	<b>mitsubishi</b> GALANT (4G32, G52B) 73~75 (4G52) 75~76 GTO 73~ FTO 1600 74~75 1850, 2000 (4G51, 4G52) 73~ 1600, 1850, 2000 16L 16L 73~ LANCER 1400, 1600 73~ CELESTE (4G32, G32B) 73~ (4G53, 4G54) 74~75 JEEP (4G52, 4G53, 4G54) 74~75 CANTER 2T (4G53, 4G54) 74~75 CANTER, ROSA (4G52, 4G53) 74~77 FORKLIFT (KE42) 73~76
<b>3NC-41</b> <b>0.22<math>\mu</math>F</b> 	<b>MD607144</b>  <b>T315T22572 MI</b>	<b>mitsubishi</b> GALANT EXPORT 76~ 1600 (4G32) 74~77 GTO 1700 75~ COUPE (4G32) 74~77 LANCER (4G33, G33B) 75~77 (4G36) 72~77 1600 (G32B, 4G32) 73~77 CELESTE (4G32, G32B) 75~76 DODGE COLT (4G32) EXPORT 75~ FORKLIFT (4G32, 4G33) 73~75
<b>3NC-42</b> <b>0.22<math>\mu</math>F</b> 	<b>MD607102</b>  <b>T315T22371 MI</b>	<b>mitsubishi</b> GALANT EXPORT 76~ (4G32, G52B, 4G52) 75~77 1850, 2000 (4G51, 4G52) 75~77 $\Sigma, \Delta$ C-A115, 122A, 123A, B-A114 76~ DODGE COLT EXPORT 75~ JEEP (4G52, AG53, AG54) 75~78 CANTER T206, 207, 216, 217 75~ ROSA B205 74~ CANTER, ROSA (4G53, 4G54) 75~77 LIGHT BUS ROSA (4G35) 75~78



# DISTRIBUTOR CONDENSERS

New-Era No.	Ref.No.	Application
<b>3NC-43</b> 	<b>0.22<math>\mu</math>F</b> <b>0453-24-322A</b> <b>(D67Z-12300A)</b> <b>MD607181</b>	<b>MAZDA</b> FAMILIA PRESTO 1000, 1300 1300 75~ EXPORT 75~ GRAND FAMILIA 1300 75~ EXPORT 75~ 1600 LUCE 1800AP SN3 75~77 C-LAVS, C-LA3VH, LA2VS, 75~ LA2VH, LA3VS EXPORT C-LA3, E-LA4VS, 75~ E-LA7V CAPELLA 1600AP SN, MN, B-CB1VS, 75~ 1800AP B-CB1VS 76~77 1600 EXPORT 75~ COSMO 1800AP C-CD2VC 76~ EXPORT C-CD2VC, 76~77 E-CD5VC PROCEED 75~ 1600 EXPORT 75~ <b>FORD</b> COURIER EXPORT 75~ <b>MITSUBISHI</b> MINICA (2G23, 2G2) 77~81 (2G23, 2G23B) 77~78 AM155 77~81 MINI CAB 77~81
		T315T22771 MI
<b>3NC-46</b> 	<b>0.22<math>\mu</math>F</b> <b>3823-24-322</b> <b>(D67Z-12300B)</b>	<b>MAZDA</b> FAMILIA PRESTO 1000, 1300 76~ H-FA2T, MP3, SP3, MP6 TRUCK, VAN MP3, SP3, MP6, SP6 76~79 GRAND FAMILIA VAN 1300 76~79 ST3EV, H-ST3AV, ST3CV 1600 SN3, SN3AV 76~ PEZIN 76~ PROCEED 1600 H-LA3VV 76~ LUCE VAN 1800 H-BA2N9 78~79 BONGO 1600 77~ 1300 929L 323 PROCEED <b>FORD</b> COURIER
		T315T23271 MI
<b>3NC-47</b> 	<b>0.27<math>\mu</math>F</b> <b>MD607406</b>	<b>MITSUBISHI</b> GALANT 1600 (4G32, G32B) 76~83 PICK UP 1600 78~ ETERNA 1600 (G32B) 76~83 LANCER (G33B, 4G1, 4G33, 4G36) 76~81 CELESTE (4G32, G32B) 78~79 1400, 1600 77~ EX1400, EX1600 79~81 TREDIA 1400 (G12B) 81~ 1600 (G32) 81~ CORDIA 1600 (G32B, 4G32) 81~ MIRAGE (G3, G12B, 4G1) 77~ 1200, 1400 (G11B, G12B, G32B) 78~ FORTE 1600 (4G32) 78~ DELICA VAN WIDE (4G32) STAR WAGON (G32B) 79~82 FORKLIFT (4G32, 4G33) 76~77 DODGE COLT, CHALLENGER 77 PLYMOUTH SAPPORO (4G32) 78 (4G32)
		T315T23971 MI


# DISTRIBUTOR CONDENSERS

New-Era No.	Ref.No.	Application
<b>3NC-48</b>  <b>0.22<math>\mu</math>F</b>	<b>E303-24-322</b>  <b>T315T24371 MI</b>	<b>MAZDA</b> 323 1500SPORTS [GENERAL] 1500(A/T) [GENERAL] 1500 [GENERAL] 1300(A/T) [GENERAL] 1300, 1000 [GENERAL]
<b>3NC-49</b>  <b>0.27<math>\mu</math>F</b>	<b>MD607530</b> <b>CLARK No.</b> <b>(909355)</b>  <b>T315T24071 MI</b>	<b>MITSUBISHI</b> DODGE COLT 77~79 CHALLENGER 77~79 PLYMOUTH SAPPORO 77~79 ARROW (4G54) 78 GALANT (4G32, G52B, 4G52) 77~78 2000 (4G52) 77~79 1850, 2000 (4G51, 4G52) 77~78 $\Sigma$ COLT $\Sigma$ (4G52) 78 JEEP (4G53, 4G54) 77~ (4G52) 78~79 LIGHT BUS (4G53) 77 ROSA (4G35) 78~ CANTER, ROSA (4G53, 4G54) 77~ FORKLIFT (4G52, 4G53) 77~78
<b>4NC-67</b>  <b>0.22<math>\mu</math>F</b>	<b>19133-60040</b> <b>90099-52009</b>  <b>949520-0610 ND</b>	<b>TOYOTA</b> LAND CRUISER FJ40, 43, 55 64~73 FJ56 73~75 TRUCK FA, FB, FC 64~73 PATROL FS20, 40, 50 69~73
<b>4NC-69</b>  <b>0.22<math>\mu</math>F</b>	<b>19133-10010</b> <b>90099-52002</b>  <b>949520-0211 ND</b>	<b>DAIHATSU</b> CHARMANT 1200 H-KD10, H-A10, H-KB10, A10 ~75 CONSORTE EP31S, EP42, EP47 DELTA 750 KD10, H-KD10, H-A10, H-KB10 ~75 1500 SV16, SV17T 2000 DV21, 26T HILINE F100, F110, F118B, F175, F200  <b>TOYOTA</b> PUBLICA UP15, 20, 30, 36, 100 ~75 KP30, 31, 36, 37, 42, 47 CORONA RT22, 40, 41, 46, 50, 53, 56, 60, 65, ~70 61, 62, 66, 67, 69, 70, 71, 72, 75, 76, 78, 81, 82, 84, 87, 90, 91, 93, 94, 96, 100, 106, 114 RT40, 46, 86 HILUX RN10, 20, 25 ~75 H-RN20, 25 ~75 HIACE RH10, 11, 13, 15, 16 CROWN RS50, 56, 60, 66 67~ COROLLA KE10, 11, 15, 16, 17, 18, 20, 25, 26, ~75 30, 35, 40 LITEACE KM10, H-KM10 ~75 STOUT RK101, 171, 176 67~ DYNA RU10, 12, 15, 18, 19 67~ CARINA RA15, 21, 25 LAND CRUISER FJ40, 43, 55 73~

# DISTRIBUTOR CONDENSERS

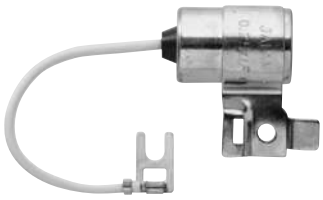




New-Era No.	Ref.No.	Application
<b>4NC-70</b>  <b>0.25<math>\mu</math>F</b>	<b>33261-52011</b>	<b>SUZUKI</b> FRONTE LS20 (L-50) 72~73 LS30T (LJ-50) 73~ SH10T (LJ50) 76~ JIMNY LJ10 (FB) 70~ LJ20 (LJ50) 71~ SJ10F (LJ50) 76~ CARRY L20, 21, 30 65~69 L40, 41 69~72 L50, 51 73~
		<b>DAIHATSU</b> CHARMANT 1400 A20, H-A20 74~75 DELTA 2000 DV23T CONSORTE EP23T FELLOW MAX C-L40, H-L40  <b>ISUZU</b> GEMINI A-PF50 (G161) ~75 1600 PF50 FASTER (G161) ~75 117 COUPE A-PA95 (G181) ~75 FLORIAN A-PA95 (G180) ~75 A-PA30 H-PA20 (G161) ~75  <b>MITSUBISHI</b> FORTE 1600 H-L021P 76~79 LANCER (4G1)[EC] 79~ CELESTE (4G32, G32B) 77~78 ESTATE VAN 76~79 GALANT $\Sigma$ 1600GS B-A121ANGS 76~77 GTO 1700 B-A55C, A-55 76~77 $\Sigma$ 1600 B-A112, A121A 76~79 E-A131A, H-A112V 76~79 1600 (4G32) 77~79 COUPE (4G32) 79 PLYMOUTH ARROW (4G32) 76~77 SAPPORO (4G32)[USA] 76~79 DODGE COLT (4G32)[AUSTRALIA] 76~79 CHALLENGER (4G32)[USA] 76~79  <b>TOYOTA</b> CORONA RT41, 53, 54, 60, 61, 62, 67, 68, 70, 71, 72, 76, 77, 82, 84, 88, 94, 102, 104, 108, 112, 114, 122, TT110, H-TT106 A-RT103, 108 ~75 MARK II RX10, 11, 12, 16, 17, 20, 21, 22, 26, 27, 28 72~75 H-RX17 HIACE H-RX18-V/C COROLLA TE20, 25, 27, 30, 31, 35, 36, 37, 40, 41, 45, 47 ~75 CELICA TA10, 11, 12, 15, 17, 20, 22, 27 ~75 CARINA RA11, 15, 21, 25 ~75 CROWN RS50, 56, 60, 66 ~75 STOUT RK101, 171, 176 ~75 DYNA RU10, 12, 15, 18, 19 ~75 HILUX RN22 ~75  <b>SUBARU(FUJI)</b> LEONE B-A26, 27 75~ E-A32, 33 77~
<b>4NC-73</b>  <b>0.22<math>\mu</math>F</b>	<b>39102-4302</b> <b>8-94206147-0</b> <b>90099-52050</b> <b>90099-52052</b> <b>MD607228</b>	<b>DAIHATSU</b> CHARMANT 1400 A20, H-A20 74~75 DELTA 2000 DV23T CONSORTE EP23T FELLOW MAX C-L40, H-L40  <b>ISUZU</b> GEMINI A-PF50 (G161) ~75 1600 PF50 FASTER (G161) ~75 117 COUPE A-PA95 (G181) ~75 FLORIAN A-PA95 (G180) ~75 A-PA30 H-PA20 (G161) ~75  <b>MITSUBISHI</b> FORTE 1600 H-L021P 76~79 LANCER (4G1)[EC] 79~ CELESTE (4G32, G32B) 77~78 ESTATE VAN 76~79 GALANT $\Sigma$ 1600GS B-A121ANGS 76~77 GTO 1700 B-A55C, A-55 76~77 $\Sigma$ 1600 B-A112, A121A 76~79 E-A131A, H-A112V 76~79 1600 (4G32) 77~79 COUPE (4G32) 79 PLYMOUTH ARROW (4G32) 76~77 SAPPORO (4G32)[USA] 76~79 DODGE COLT (4G32)[AUSTRALIA] 76~79 CHALLENGER (4G32)[USA] 76~79  <b>TOYOTA</b> CORONA RT41, 53, 54, 60, 61, 62, 67, 68, 70, 71, 72, 76, 77, 82, 84, 88, 94, 102, 104, 108, 112, 114, 122, TT110, H-TT106 A-RT103, 108 ~75 MARK II RX10, 11, 12, 16, 17, 20, 21, 22, 26, 27, 28 72~75 H-RX17 HIACE H-RX18-V/C COROLLA TE20, 25, 27, 30, 31, 35, 36, 37, 40, 41, 45, 47 ~75 CELICA TA10, 11, 12, 15, 17, 20, 22, 27 ~75 CARINA RA11, 15, 21, 25 ~75 CROWN RS50, 56, 60, 66 ~75 STOUT RK101, 171, 176 ~75 DYNA RU10, 12, 15, 18, 19 ~75 HILUX RN22 ~75  <b>SUBARU(FUJI)</b> LEONE B-A26, 27 75~ E-A32, 33 77~
	<b>949520-1800 ND</b> <b>T315T22073 MI</b>	
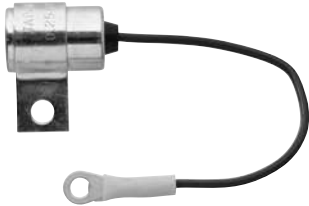
# DISTRIBUTOR CONDENSERS

New-Era No.	Ref.No.	Application
4NC-74	0.25 $\mu$ F	
		<b>DAIHATSU</b> CHARMANT 1400 1600 FELLOW MAX MAX CUORE CUORE(COLD) DELTA 1500, 2000 DELTA WIDE <b>ISUZU</b> 117 COUPE 1800 FASTER GEMINI 1600 1800 FLORIAN 1800 CHEVROLET TROOPER, CARIBE 442 <b>MITSUBISHI</b> GALANT $\Sigma$ , $\Delta$ 1800 $\Sigma$ ESTATE VAN ETERNA $\Sigma$ , $\Delta$ 1800 $\Sigma$ ESTATE VAN LANCER EX1800 PAJERO 2000 DELICA WAGON 1800 <b>SUBARU(FUJI)</b> SUBARU 600 <b>SUZUKI</b> FRONTE CARRY 800 CERVO JIMNY 8 <b>TOYOTA</b> CROWN CORONA 1600 MARK II CELICA COROLLA, SPRINTER, DYNA HIACE STOUT COASTER HILUX MARK II 1800
		A-20, H-A20 75~ J-A40V (12T-J) 79~81 L40 C-L40 (AB10) 77~79 H-L40V (AB30) 77~80 E-L45 (AB40) 79~80 E-L55 (AB40) 80~ V3# (5R) 77~83 H-TB10V (2T-J) 78~81 J-TB11V (2T-J) 79~82 A-PA95 (G181) 75~79 PA95N (S) (G180Z) 76~77 (G161) 75~ A-PF50 (G161) 75~78 B-PF50 PF50 (G161Z) 76~78 PF60E (G180Z) 77~78 PA30 (G180Z) 76~78 E-A162A (G62B) 80~ J-A163V (4G63) 80~ L-A168V (G63B) 81~ E-A162A (G62B) 80~ J-A163V (4G63) 80~ L-A168V (G63B) 81~ E-A175A (G62B) 80~ L-L041G (G63B) 82~ E-L035PW (G62B) 80~ 77~81 T-S, C-SS-11 (AB10) 78~79 E-SS40 (F5A) 79~ SJ410V 83~ SS80F, SS80AF 83~ ST80, 80K, 80V, 90, 90K, 90V 80~ SC80 80~ LJ-80QL H-SJ20 (F8A) 77~ RS60, 80 75~ RT102,108,112, H-RT108,TT100,110,H-TT106 75~ H-TT137V (2T-J) 78~79 J-TT138V (12T-J) 79~81 RX11, 12, 17, 22, 28, 21, 27 75~ H-RX17 RA11, 15, 21, 25 75~ TA10, 12, 15, 17, 20, 22, 27 75~ H-TA16, H-TA19 75~ TE3#, 4#, H-TE36 H-RH12, 14, 17 75~ RK101 75~ RU10, 12, 15, 19R 75~ RN30, 40 (12R#) 75~ J-TX47V (13T-J) 79~80
	949520-2540 ND	



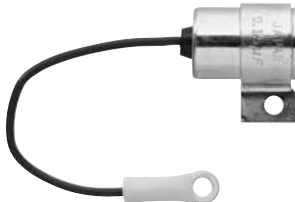


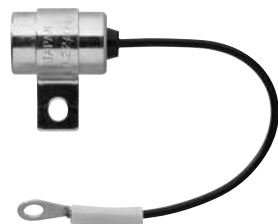
# DISTRIBUTOR CONDENSERS


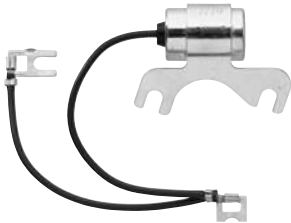
New-Era No.	Ref.No.	Application
<b>4NC-75</b> <b>0.15<math>\mu</math>F</b> 	<b>19133-41010</b> <b>19133-41011</b>	<b>TOYOTA</b> CROWN MS50, 51, 52, 56, 60, 62, 65, 66, 70, 75 CORONA MX10, 20 COROLLA KE20, 25, 26, 30, 35, 36, 40 PUBLICA KP30, 31, 36, 37, 40, 42, 45, 47 LITEACE KM10
<b>4NC-76</b> <b>0.15<math>\mu</math>F</b> 	<b>90099-52053</b>  <b>949520-2320 ND</b>	<b>TOYOTA</b> CROWN MS60, 62, 66, 70, 80, 82, 87, 90, MS50D, CD, 51B, 52, 50P, 60P, 70HS, KS CORONA MARK II MS65, 75 MX10, 20, 27
<b>4NC-79</b> <b>0.25<math>\mu</math>F</b> 	<b>90099-52060</b>  <b>949520-2580 ND</b> <b>949520-2680 ND</b> <b>949520-5280 ND</b>	<b>DAIHATSU</b> TAFT JEEP F20, 12R CHARMANT 1200 H-A10V (3K-HJ) CHARMANT 1300 J-A30V (4K-J) CHARMANT 1400 H-A20V (T-J) DELTA 750 H-KD11 (4K-J) DELTA WIDE J-KD20 (4K-J, OPTION) H-KB11V (4K-J) J-KB12V (4K-J)  <b>TOYOTA</b> COROLLA STARLET CARINA HILUX RN30, 40 (12R)
<b>4NC-80</b> <b>0.18<math>\mu</math>F</b> 	<b>90099-87701</b>  <b>949520-2630 ND</b>	<b>DAIHATSU</b> HI-JET H-S40 (AB10) 550 H-S40 (AB) 55 WIDE J-S40 (AB20) H-S60 (AB20) J-S60 (AB20) J-S65 (AB20) J-S65Y (AB20)
<b>4NC-81</b> <b>0.27<math>\mu</math>F</b> 	<b>90099-42034</b>  <b>949520-2710 ND</b>	<b>DAIHATSU</b> CHARADE E-G10 (CB10, 11, 31, 32) E-G11 (CB12, 22, 33)

DISTRIBUTOR CONDENSERS

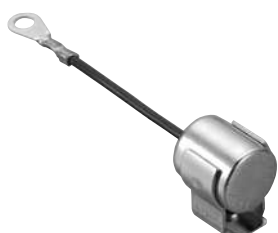


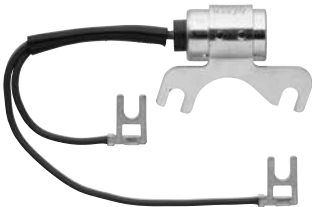
# DISTRIBUTOR CONDENSERS

New-Era No.	Ref.No.	Application
<b>4NC-82</b> <b>0.25<math>\mu</math>F</b> 	<b>90099-52068</b>  <b>949520-2810 ND</b>	<b>TOYOTA</b> HIACE J-RH35, 45 (18R, 18R-J) 79~
<b>4NC-83</b> <b>0.25<math>\mu</math>F</b> 	<b>90099-52062</b>  <b>949520-2670 ND</b>	<b>TOYOTA</b> COASTER HILUX RB11, J-RB12 (20R, 22R) J-RN36 (18R-J) 77~80 79~
<b>4NC-84</b> <b>0.47<math>\mu</math>F</b> 	<b>19133-16240</b>	<b>TOYOTA</b> STARLET TERCEL PASEO SOLUNA VIOS/SOLUNA VIOS COROLLA  CELICA  CORONA  CAMRY RAV4 4RUNNER DYNA200 LAND CRUISER 90  EP82/EP91 (4E-FE) 92~ EL53 (5E-FE) 94~95 EL44/54 (5E-FE) 91~ AL50 (5A-FE) 96~03 AXP4# (5A/8A-FE) 02~ AE10# (4A/5A/7A-FE) 91~ EE101/104 (4E/5E-FE) 92~97 AE112 (7E-FE) 98~99 AE111 (4A-FE) 95~ AE110/112 (5A/7A-FE) 95~ EE111 (4E-FE) 95~ ST184 (5S-FE) 91~93 ST202/204 (3S/5S-FE) 93~ AT190 (4E-FE) 92~97 ST191 (3S-FE) 92~ AT210 (4A-FE) 98~ ST210 (3S-FE) 96~ AT220 (4A-FE) 97~ SXV1# (3S/5S-FE) 92~97 SXA1# (3S-FE) 94~96 RZN185 (3RZ-FE) 95~ RZU100 (3RZ-FE) 97~ RZJ9# (3RZ-FE) 96~02
<b>4NC-86</b> <b>0.22<math>\mu</math>F</b> 	<b>22102-50001</b> <b>22102-50002</b>  <b>4207-1340 HI</b>	<b>NISSAN(DATSUN)</b> TRUCK V8 MARINE PRESIDENT CABIN CRUISER E1 74 YA190 73~ H150 80 YA190 (Y44)



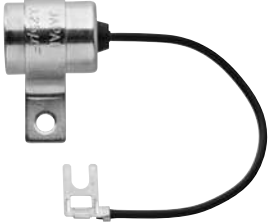
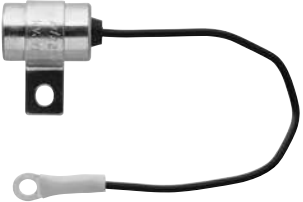

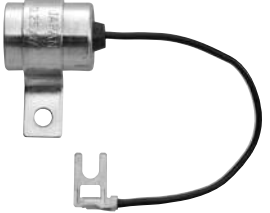
# DISTRIBUTOR CONDENSERS

New-Era No.	Ref.No.	Application
<b>4NC-87</b> 	<b>0.22<math>\mu</math>F</b> 49102-7801 89102-4101 22102-00800 22102-00801 30108-634-005 30108-PA1-005 9-82311722-0 9-82315207-0	<b>HONDA</b> CIVIC 73~79
		<b>ISUZU</b> 117 COUPE 1800XE PA90, PA95, AP95, PR95 73~ PA95, PA90E, PA90HE 76~ BELLET PA95, PR95, PA30, KB20 73~ ELF, BUS BLG, TLG, BLD 71~73 ELF 150 KAG (G161) 73~ 250 KAG (G161) 70 1500 TLG (G201) 73~ FASTER KA41, KA51, KAG 73~ KB20 74~
	<b>NISSAN(DATSUN)</b> BLUEBIRD 441, 510, 520, 610, 710 65~70 TRUCK 411, 520, 521, 620, 681, 690, 694, 780, C80, W73 65~ VIOLET 710, K710, KP710, JP710, JKP710 73~74 SUNNY B10, 110, 210, (A14S) 66~ KB210GK, VB210, VB310 (A12) CHERRY E10, F10, PE10 70~74 JUNIOR 40, 41, 130, 140 64~ CABSTAR 521, 620, 780, A321 72~ CARAVAN E20 73~76 CLIPPER T650 66~ SKYLINE GC106, 230, C10 68~ PATROL J-G60 (P40) 79~80 J-FG61 (PF40) 80 BUS 60, G60, 4W73, G681, FS681, E690 66~ GLORIA A-K330 75 FAIRLADY 30, 110, 130 72~75 LAUREL KC30, KPC30, C30, 130 68~74 PRESIDENT C80, 250A, 250AC 73~ CEDRIC 130, GC106, 230, 31, 41, L20 64~ A330, V330 75~ VAN V430 (L20S) 81 PULSAR VAN 1200 J-VN10 (A12S) 79~81 1400 J-NHN10 (A14S) 79~80	
	<b>SUBARU(FUJI)</b> LEONE 1400 A22A, A22, A22B, A25B, A62B, A65B 73~ 1200, 1400 A22C, A22J, A25C 75~ COUPE 1400 A22S, A22A 71~ VAN 1200, 1400, 1600, 1800 77~ A33 (EA63, EA71) FF-1 1300G A44A, A15A, A14, A15Z 70~ 1000 A14, A15Z 70~	
	4461-1340 HI 44J80-13401 HI	
<b>4NC-89</b> 	<b>0.22<math>\mu</math>F</b> 22102-U6001 22102-U6002 22102-U6003 22102-U6004 30108-657-005	<b>NISSAN(DATSUN)</b> SKYLINE GC110, 111, G610, C211, 331 75~ SILVIA S10 76~ LAUREL A-GC110, HC130, HC131 75~ C-HC230 76~77 JUNIOR C240R, C240PR, HC240WR 75~ CARAVAN VPE20, VSE20 77~ STANZA E-PA10E BLUEBIRD U GC100, G610, C331 76~ C-P810, C-PJ810, E-P811, PG810E, FAIRLADY A-S30, A-GS30 (L20E) 76~78 S30, GS30 76~ SUNNY B211, 310 (A12A, A14) 76~ FF1300 E-B11 (E13S) 1500 E-PB310 (A15S, A15E) CALIFORNIA E-HB310 (A14E) 79 CEDRIC, GLORIA N230P 75~ PULSAR YN10, E-HN10, E-YN10, (A12A, A14S, A14E) 77~ 1300 E-PN12 (M/T) (E13S) 82 CHERRY F11, PF10, PF11, KPF10A-KPC20 74~ VIOLET 710, P710E, PA10 75~ AUSTER 710, PA10 75~
		44A4-13403 HI 44A4-13404 HI 44A4-13405 HI T315T23571 MI

# DISTRIBUTOR CONDENSERS



New-Era No.	Ref.No.	Application
<b>4NC-92</b> <b>0.25<math>\mu</math>F</b> 	90099-52076	<b>TOYOTA</b> CORONA 1800 COROLLA AT151 (1SL) AE80EX, 82E (2AL, 4AL) 83~ 83~
<b>4NC-93</b> <b>0.22<math>\mu</math>F</b> 	22102-D1100	<b>NISSAN(DATSUN)</b> BLUEBIRD TRUCK VIOLET SUNNY CHERRY JUNIOR CABSTAR CARAVAN CLIPPER SKYLINE PATROL BUS GLORIA FAIRLADY LAUREL PRESIDENT CEDRIC VAN PULSAR VAN 1200 VAN 1400 441, 510, 520, 610, 710 411, 520, 521, 620, 681, 690, 694, 780, C80, W73 710, K710, KP710, JP710, JKP710 B10, 110, 210, (A14S) KB210GK, VB210, VB310 (A12) E10, F10, PE10 40, 41, 130, 140 521, 620, 780, A321 E20 T650 GC106, 230, C10 J-G60 (P40) J-FG61 (PF40) 60, G60, 4W73, G681, FS681, E690 A-K330 30, 110, 130 KC30, KPC30, C30, 130 C80, 250A, 250AC 130, GC106, 230, 31, 41, L20 A330, V330 V430 (L20S) J-VN10 (A12S) J-NHN10 (A14S) 65~70 65~ 73~74 66~ 70~74 64~ 72~ 73~76 66~ 68~ 79~80 80 66~ 75 72~75 68~74 73~ 64~ 75~ 81 79~81 79~80
<b>4NC-95</b> <b>0.22<math>\mu</math>F</b> 	22102-01M11	<b>NISSAN(DATSUN)</b> DATSUN 720 D21 (Z20) 85~
<b>4NC-96</b> <b>0.22<math>\mu</math>F</b> 	22102-01B01	<b>NISSAN(DATSUN)</b> MARCH MARCH (A/T) MARCH (MT) E-K10 [MA10] E-BK10 [MA10S] E-BK10 [MA10S] 87~ 86~ 86~
	44A86-13401 HI	
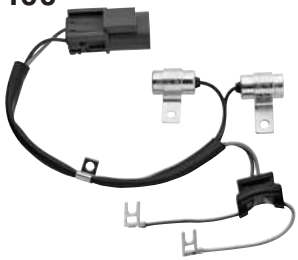
# DISTRIBUTOR CONDENSERS

New-Era No.	Ref.No.	Application
<b>4NC-100</b> 	22159-60A20	NISSAN(DATSUN) TSURU E15 [MEXICO] B11 [MEXICO] 84~88
<b>4NC-173</b> <b>0.22<math>\mu</math>F</b> 		HONDA ISUZU MITSUBISHI SUBARU(FUJI) TOYOTA 4NC-73 TYPE OPEN CLIP
<b>4NC-174</b> <b>0.25<math>\mu</math>F</b> 		HONDA ISUZU MITSUBISHI SUBARU(FUJI) SUZUKI TOYOTA 4NC-74 TYPE OPEN CLIP
<b>4NC-273</b> <b>0.22<math>\mu</math>F</b> 		HONDA ISUZU MITSUBISHI SUBARU(FUJI) TOYOTA 4NC-73 TYPE
<b>4NC-7315</b> <b>0.15<math>\mu</math>F</b> 		HONDA ISUZU MITSUBISHI TOYOTA 4NC-173 TYPE
<b>4NC-8725</b> <b>0.25<math>\mu</math>F</b> 		HONDA ISUZU NISSAN(DATSUN) SUBARU(FUJI) 4NC-87 TYPE OPEN CLIP

DISTRIBUTOR CONDENSERS

# DISTRIBUTOR CONDENSERS

New-Era No.	Ref.No.	Application
<b>NCD-554</b> <b>0.25<math>\mu</math>F</b> 		DELCO REMY UNIVERSAL TYPE
<b>NCD-701</b> <b>0.25<math>\mu</math>F</b> 	2101-37064-00 9913848	LADA FIAT

## NOISE CONDENSERS

New-Era No.	Ref.No.	Application
<b>NCM-905</b> <b>(150V 0.5<math>\mu</math>F)</b> 